SOCIUS ENGG. TECH. PVT. LTD.

AN ISO 9001: 2015, MSME. CERTIFIED COMPANY

Test Report on Pre-Polished Cement Concrete Designer Tiles

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer Project, Yelahanka BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Online WO:	EE(PROJECT)/YNK ZONE/WO/179/2020-21
Condition of Samples:	Satisfactory
Test According to:	IS: 1237-1980 (Reaffirmed 2006)
Date of Testing:	28-06-22

I. Wet Transverse Strength Test:

Sl. No.	Measured Dimension in mm	Wet Transverse Strength Test N/mm²	Average N/mm²	Requirement as per IS: 1237-1980(Reaffirmed 2006)
1	300x300x24.8	6.6	6.65	The average wet transverse strength should not be less than 3.0 N/mm² when 6 full size tiles are tested.
2	300x300x23.7	7.1		
3	300x300x24.5	7.0		
4	300x300x24.8	6.5		
5	300x300x25.1	6.3		

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SOCIUS ENGG. TECH. PVT. LTD.
AN ISO 9001: 2015, MSME. CERTIFIED COMPANY

Test Report on Pre-Polished Cement Concrete Designer Tiles

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer Project, Yelahanka BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Online WO:	EE(PROJECT)/YNK ZONE/WO/179/2020-21
Condition of Samples:	Satisfactory
Test According to:	IS: 1237-1980 (Reaffirmed 2006)
Date of Testing:	28-06-22

I. Wet Transverse Strength Test:

Sl. No.	Measured Dimension in mm	Wet Transverse Strength Test N/mm²	Average N/mm²	Requirement as per IS: 1237-1980(Reaffirmed 2006)
1	300x300x24.8	6.6	6.65	The average wet transverse strength should not be less than 3.0 N/mm² when 6 full size tiles are tested.
2	300x300x23.7	7.1		
3	300x300x24.5	7.0		
4	300x300x24.8	6.5		
5	300x300x25.1	6.3		

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

6	300x300x24.9	6.4		

II. Water Absorption Test

Sl. No.	Measured Dimension in mm	Wet Transverse Strength Test N/mm²	Average N/mm²	Requirement as per IS: 1237-1980(Reaffirmed 2006)
1	300x300x24.8	2.8	2.95	The average percentage of water absorption should not exceed 10% when 6 full size tiles are tested.
2	300x300x23.7	2.9		
3	300x300x24.5	3.1		
4	300x300x24.8	2.9		
5	300x300x25.1	3.2		
6	300x300x24.9	2.8		

III. Hardness:

Sl. No.	Measured Dimension in mm	Moh's scale Hardness No.
1	300x300x24.8	6
2	300x300x23.7	6
3	300x300x24.5	6
4	300x300x24.8	6
5	300x300x25.1	6
6	300x300x24.9	6

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:3:6

TEST REPORT ON CEMENT

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duo marvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	Satisfactory
Test According to:	Relevant IS code
Date of Testing:	21-05-22

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SL no	Description	Test Method as per IS	Test Result	Remarks
1	a) Initial setting time	IS: -4031 (part-5)	128 Minutes	ok
	b) Final setting time	IS: -4031 (part-5)	460Minutes	ok
2	Soundness	IS: 4031 (part-3) La-Chatelier method	3.0 mm	ok
3	Standard Consistency	IS: -4031 (part-4)	25.00%	ok
4	Compressive Strength			
	a) 3 Days	Mpa	26	ok
	b) 7 Days	Mpa	37	ok

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

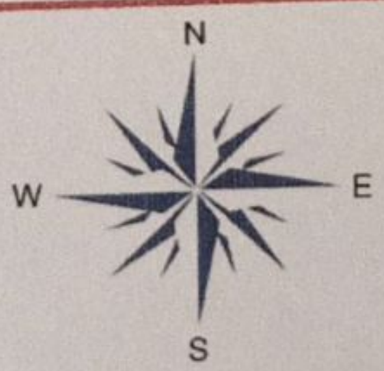

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:3:6

TEST REPORT ON CEMENT

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duo marvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	Satisfactory
Test According to:	Relevant IS code
Date of Testing:	27-05-22

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

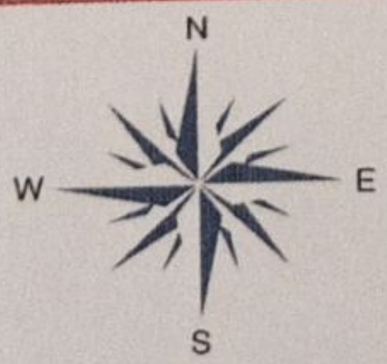

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SL no	Description	Test Method as per IS	Test Result	Remarks
1	c) Initial setting time	IS: -4031 (part-5)	128 Minutes	ok
	d) Final setting time	IS: -4031 (part-5)	460Minutes	ok
2	Soundness	IS: 4031 (part-3) La-Chatelier method	3.0 mm	ok
3	Standard Consistency	IS: -4031 (part-4)	25.00%	ok
4	Compressive Strength			
	c) 3 Days	Mpa	26	ok
	d) 7 Days	Mpa	37	ok

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:3:6

TEST REPORT ON CEMENT

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duo marvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	Satisfactory
Test According to:	Relevant IS code
Date of Testing:	03-06-22

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

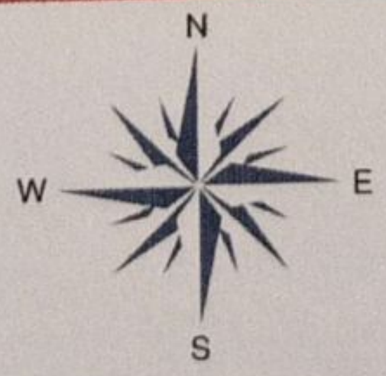

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SL no	Description	Test Method as per IS	Test Result	Remarks
1	e) Initial setting time	IS: -4031 (part-5)	128 Minutes	ok
	f) Final setting time	IS: -4031 (part-5)	460Minutes	ok
2	Soundness	IS: 4031 (part-3) La-Chatelier method	3.0 mm	ok
3	Standard Consistency	IS: -4031 (part-4)	25.00%	ok
4	Compressive Strength			
	e) 3 Days	Mpa	26	ok
	f) 7 Days	Mpa	37	ok

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:3:6

TEST REPORT ON CEMENT

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duo marvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	Satisfactory
Test According to:	Relevant IS code
Date of Testing:	22-06-22

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SL no	Description	Test Method as per IS	Test Result	Remarks
1	g) Initial setting time	IS: -4031 (part-5)	128 Minutes	ok
	h) Final setting time	IS: -4031 (part-5)	460Minutes	ok
2	Soundness	IS: 4031 (part-3) La-Chatelier method	3.0 mm	ok
3	Standard Consistency	IS: -4031 (part-4)	25.00%	ok
4	Compressive Strength			
	g) 3 Days	Mpa	26	ok
	h) 7 Days	Mpa	37	ok

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

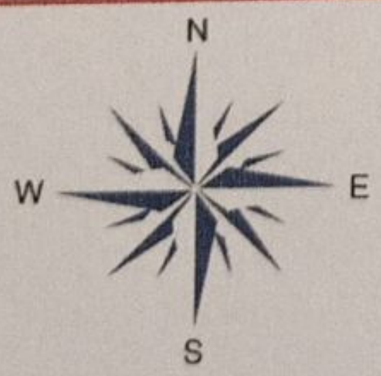

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:2:4

TEST REPORT ON CEMENT

Name of work:	**Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division**
Location:	**Duo marvels Layout And Nisarga Park**
Client:	**Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore**
Name of the Agency:	**Sri. N. Jagadish**
Reference:	**EE(Project)/Ynk Zone/WO/179/2020-21**
Condition of Samples:	**Satisfactory**
Test According to:	**Relevant IS code**
Date of Testing:	**01-06-22**

SOCIUS ENGG. TECH PVT. LTD. Behgaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

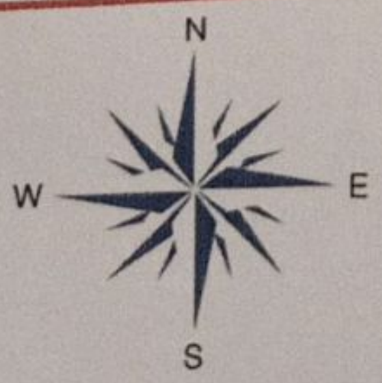

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SL no	Description	Test Method as per IS	Test Result	Remarks
1	i) Initial setting time	IS: -4031 (part-5)	128 Minutes	ok
	j) Final setting time	IS: -4031 (part-5)	460Minutes	ok
2	Soundness	IS: 4031 (part-3) La-Chatelier method	3.0 mm	ok
3	Standard Consistency	IS: -4031 (part-4)	25.00%	ok
4	Compressive Strength			
	i) 3 Days	Mpa	26	ok
	j) 7 Days	Mpa	37	ok

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

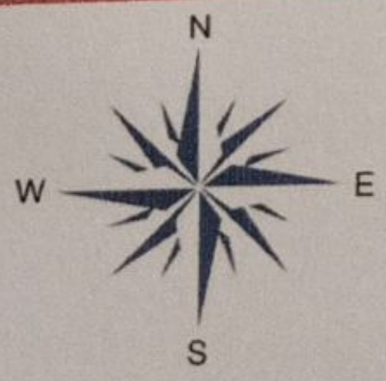

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:2:4

TEST REPORT ON CEMENT

Name of work:	**Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division**
Location:	**Duo marvels Layout And Nisarga Park**
Client:	**Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore**
Name of the Agency:	**Sri. N. Jagadish**
Reference:	**EE(Project)/Ynk Zone/WO/179/2020-21**
Condition of Samples:	**Satisfactory**
Test According to:	**Relevant IS code**
Date of Testing:	**03-06-22**

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

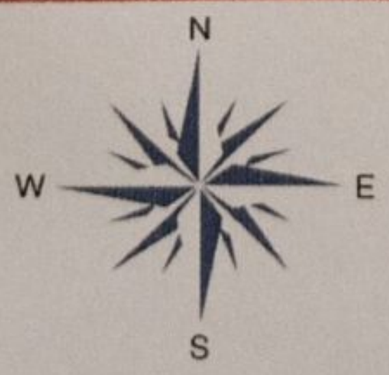

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SL no	Description	Test Method as per IS	Test Result	Remarks
1	k) Initial setting time	IS: -4031 (part-5)	128 Minutes	ok
	l) Final setting time	IS: -4031 (part-5)	460Minutes	ok
2	Soundness	IS: 4031 (part-3) La-Chatelier method	3.0 mm	ok
3	Standard Consistency	IS: -4031 (part-4)	25.00%	ok
4	Compressive Strength			
	k) 3 Days	Mpa	26	ok
	l) 7 Days	Mpa	37	ok

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

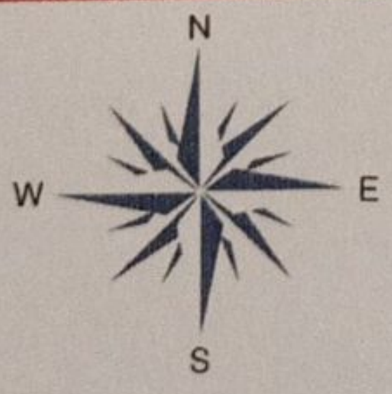

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SOCIUS ENGG. TECH. PVT. LTD.
AN ISO 9001: 2015, MSME. CERTIFIED COMPANY

Material Tests for Concrete 1:3:6

TEST REPORT ON FINE AGGREGATE

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	IS 383-1970 (RA-2002), Satisfactory
Test According to:	Relevant IS code
Date of Testing:	21-05-22

SAMPLE ID: Sand Total Wt of Aggregate in Gms: 1350

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SOCIUS ENGG. TECH. PVT. LTD.

IS Sieve Size in mm	Weight of Retained (grms)	Cumulative Weight of Retained (grms)	Cumulative % of Retained (grms)	Cumulative % of passing	Percentage Passing for grading zone II as per IS 383-1970
10	0	0	0	100	100
4.75	30	30	2.22	97.78	90-100
2.36	62	92	6.81	93.82	75-100
1.18	90	182	13.48	86.52	55-90
600 Micron	480	662	49.03	50.97	35-59
300 Micron	358	1020	75.55	24.45	8-30
150 Micron	325	1345	99.62	0.38	0-10

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:3:6

TEST REPORT ON FINE AGGREGATE

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	IS 383-1970 (RA-2002), Satisfactory
Test According to:	Relevant IS code
Date of Testing:	27-05-22

SAMPLE ID: Sand Total Wt of Aggregate in Gms: 1350

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

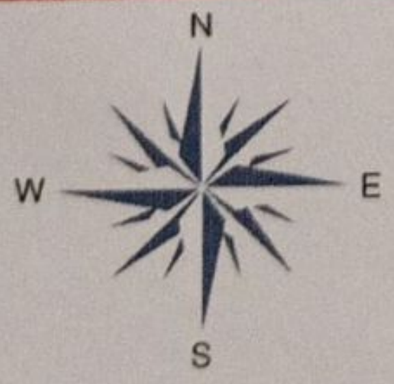

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

SOCIUS ENGG. TECH. PVT. LTD.

AN ISO 9001: 2015, MSME. CERTIFIED COMPANY

IS Sieve Size in mm	Weight of Retained (gms)	Cumulative Weight of Retained (gms)	Cumulative % of Retained (gms)	Cumulative % of passing	Percentage Passing for grading zone II as per IS 383-1970
10	0	0	0	100	100
4.75	30	30	2.22	97.78	90-100
2.36	62	92	6.81	93.82	75-100
1.18	90	182	13.48	86.52	55-90
600 Micron	480	662	49.03	50.97	35-59
300 Micron	358	1020	75.55	24.45	8-30
150 Micron	325	1345	99.62	0.38	0-10

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241
Website: www.sociusengg.com

Scanned by TapScanner

Material Tests for Concrete 1:3:6

TEST REPORT ON FINE AGGREGATE

Name of work:	Package No-10 1.Improvements to Vivekananda Stadium and providing Indoor Gym Equipments to Hoysala Ground In Ward No.03 and 04 in Yelahanaka Satelite Town Sub Division 2.Improvements to Park, Nisarga Park and Playground in Duomarvels Layout in Ward No.03 in Yelahanaka Satelite Town Sub Division 3.Improvements to Parks at 21st Main Judicial Layout in ward No. 04 of Yelahanaka Satelite Town Sub Division 4.Improvements to Parks in Ward No.04 in Yelahanaka Satelite Town Sub Division
Location:	Duo marvels Layout And Nisarga Park
Client:	Assistant Executive Engineer, Yelahanka Project BBMP, Bangalore
Name of the Agency:	Sri. N. Jagadish
Reference:	EE(Project)/Ynk Zone/WO/179/2020-21
Condition of Samples:	IS 383-1970 (RA-2002), Satisfactory
Test According to:	Relevant IS code
Date of Testing:	03-06-22

SAMPLE ID: Sand Total Wt of Aggregate in Gms: 1350

SOCIUS ENGG. TECH PVT. LTD. Bengaluru 560 010

AE

Asst. Executive Engineer
Project Division
Yelahanka Zone
BBMP, Bangalore - 92

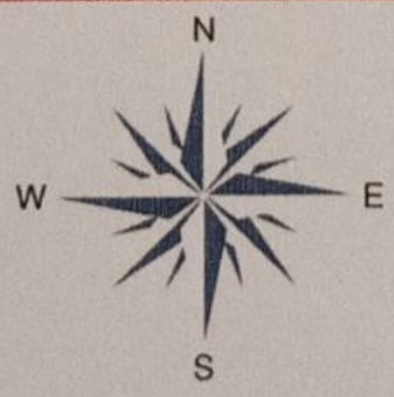

#363, 19th Main Road, 1st Block,
Rajajinagar, Bengaluru – 560010
E-Mail: support@sociusengg.com
Call: 7259425099, 8951206241.
Website: www.sociusengg.com

Scanned by TapScanner